
do

व्यावसायिक परीक्षण रिपोर्ट COMMERCIAL TEST REPORT

संख्या/ No.: ROTAVATOR-307/2576/2020

माह/Month: November, 2020

THIS TEST REPORT VALID UP TO : 30th November, 2027

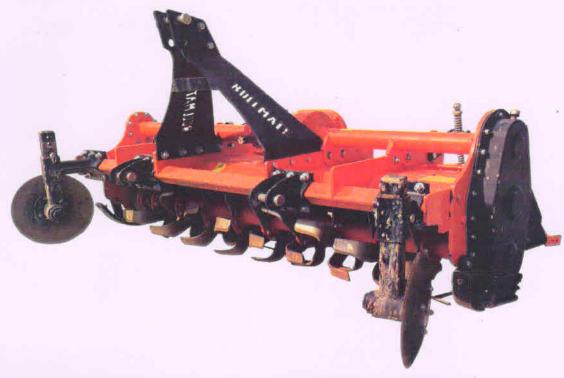

BULLMATE, BMG-600 ROTAVATOR (TRACTOR MOUNTED)



भारत सरकार

Government of India कृषि एवं किसान कल्याण मंत्रालय Ministry of Agriculture and Farmers Welfare

कृषि, सहकारिता एवं किसान कल्याण विभाग

Department of Agriculture, Cooperation and Farmers Welfare उत्तरी क्षेत्र कृषि मशीनरी प्रशिक्षण एवं परीक्षण संस्थान

Northern Region Farm Machinery Training and Testing Institute

ट्रैक्टर नगर, सिरसा रोड, हिसार, (हरियाणा) - 125 001

Tractor Nagar, Sirsa Road, HISAR (Haryana)-125 001 [ISO 9001:2015 CERTIFIED]

Website: http://nrfmtti.gov.in/

E-mail: fmti-nr@nic.in

Tele./FAX: 01662-276984

Page 1 of 22

BULLMATE, BMG-600 ROTAVATOR (TRACTOR MOUNTED) (COMMERCIAL)

4.11 Lubricants:

Sl. No.	Particulars	As recommended by the manufacturer	As used during test	
1	Primary Gear box	SAE-140 with Grease	Oil originally filled in the rotavator was not	
2	Secondary Gear box	SAE-140 with Grease	changed	
3	Rotor Hub	Not specified	M.P. Grease	
4	Propeller Shaft	Not specified		

5. RUNNING-IN

Rotavator was run in for 1.25 hour before field performance test.

6. LABORATORY TEST

6.1 Hardness: - The surface hardness of blade was recorded as under: -

Description	As per IS:	Hardness as	Remarks	
	6690:1981 (HRC)	observed (HRC)		
Edge portion	53 to 59	43.2	Does not conform	
On shank portion	37 to 45	41.13	Conforms	

6.2 Chemical composition

The chemical composition of blades is tabulated as under:-

Constituents	As per IS: 6690-1981		Composition	Remarks
	Carbon Steel	Silicon Manganese steel	as observed (% of weight)	(ell lit
Carbon (C)	0.70 -0.85	0.50-0.60	0.1293	Does not conform
Silicon (Si)	0.10 -0.40	1.50-2.00	0.3980	Conforms to carbon steel
Manganese (Mn)	0.50 -1.0	0.50-1.00	1.0054	Does not conform
Sulphur (S)	0.05(max)	0.05(max)	0.0460	Conforms
Phosphorous (P)	0.05(max)	0.05(max)	0.0251	Conforms

7. FIELD PERFORMANCE TEST

The field tests of the rotavator comprising of dry land and wet land operation were conducted for 26 and 10 hours respectively to assess the performance test is reported in **Annexure-I & II** for dry land and wet land operation respectively.

Observations of field performance test is summarized in the ensuing table:-

BULLMATE, BMG-600 ROTAVATOR (TRACTOR MOUNTED) (COMMERCIAL)

Summary of Field Performance Test

Sl. No.	Parameters/operations	Dry land operation	Wet land operation (Puddling)		
I	II	Ш	IV		
1.	Tractor used	ACE, I	OI 550		
2.	Gear used	L-2	L-2		
3.	Type of soil	Sandy loam			
4.	Average soil moisture (%)	7.25 to 10.5			
5.	Average depth of standing water (cm)		11.70 to 12.2		
6.	Bulk density of soil (g/cc)	1.620 to 1.730			
7.	Average speed of operation (kmph)	2.63 to 2.82	2.66 to 2.71		
8.	Avg. travel reduction (%)		-0.51 to -0.25		
9.	Avg. wheel slip (%)	-2.63 to 0.59			
10.	Average depth of puddle (cm)	/==	26.2 to 28.3		
11.	Average depth of cut (cm)	6.78 to 7.28	-		
12.	Avg. effective width (cm)	154 to 170			
13.	Area covered (ha/h)	0.353 to 0.427			
14.	Time required for one ha (h)	2.34 to 2.83			
15.	Field efficiency (%)	79 to 91			
16.	Puddling index (%)	**	80 to 82		
17.	Fuel consumption				
	1/h	4.95 to 6.52	3.15 to 3.44		
	l/ha	11.59 to 17.05			

7.1 Dry land operation

7.1.1 Rate of work

- i) The rate of work was recorded as 0.353 to 0.427 ha/h, and the speed of operation varies from 2.63 to 2.82 kmph.
- ii) The time required to cover one hectare was recorded as 2.34 to 2.83 h

7.1.2 Quality of work

- i) The depth of operation was recorded as 6.78 to 7.28 cm.
- ii) Average effective width was observed as 154 to 170 cm.
- iii) Field efficiency was observed as 79 to 91 %.

7.2 Wet Land operation

7.2.1 The tractor was fitted with half cage wheel on rear pneumatic traction wheel for conducting the puddling operation. The brief specification of half cage wheel is given in Annexure-III

7.2.2 Quality of work

- i) The depth of puddle was recorded as 26.2 to 28.3 cm.
- ii) The puddling index was recorded as 80 to 82 %.

BULLMATE, BMG-600 ROTAVATOR (TRACTOR MOUNTED) (COMMERCIAL)

7.3 Labour requirement

In all, two skilled operators are needed to ensure continuous operation of rotavator for day long period.

7.4 Wear analysis (on mass basis)

Wear of hatchet blades (on mass basis) was measured and recorded in ensuing table:

Percentage wear of rotavator blades on mass basis

SI. No.	Initial mass of blade (g)	Mass of blade after 37.17 hr. of operation (g)	Difference of weight (g)	Percentage of wear (%) after 37.17 hr.	Percentage of wear on hour basis (%)
1.	979.6	884.5	95.1	9.71	0.26
2.	1002.7	902.2	100,5	10.02	0.27
3.	980.7	885.0	95.7	9.76	0.26
4.	1008.2	907.7	100.5	9.97	0.27
5.	997.1	899.1	98	9.83	0.26
6.	990.4	872.1	118.3	11.94	0.32
7.	983.0	870.3	112.7	11.46	0.31
8.	974.1	859.6	114.5	11.75	0.32
9.	1001.8	895.7	106.1	10.59	0.28

8. EFFECTIVENESS OF SEALINGS

After completion of wet land operation for 10 hours, the rotavator was dismantled for checking the effectiveness of sealing provided against ingress of dust, and water/mud in various sub-assemblies/components. The observations are given in ensuing table:-

Sl. No.	Location	Whether ingress of mud and/or water was observed (Yes/No)
1.	Primary reduction gear box	No
2.	Secondary reduction gear box	No
3.	Rotor assembly (hub)	No

9. EASE OF OPERATION & ADJUSTMENTS


No noticeable difficulty was observed during the operation and adjustment of rotavator.

10. DEFECTS, BREAKDOWN AND REPAIRS

No noticeable defect or breakdown was observed during the test.

11. CRITICAL TECHNICAL SPECIFICATION

Deferred till 31.12.2020 vide Ministry O.M. No 13-13/2020 M&T, (I&P) dated 24.04.2020

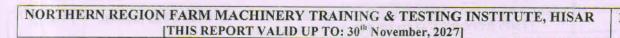

12. COMMENTS AND RECOMMENDATIONS

- 12.1 The Dimension of three point linkage of implement does not conform, in toto, to the requirements of IS: 4468(Part-1)-1997 and therefore, it may be looked into for corrective action.
- The Dimensions of PIC of implement does not conform, in toto, to the requirements of IS: 4931-1995 and therefore, it may be looked into for corrective action.
- 12.3 Provision against overload on P.T.O drive shaft is not provided. It MUST be provided.
- 12.4 The grade of grease is not specified. It MUST be specified.
- 12.5 The stand is not provided. It MUST be provided.
- 12.6 The hardness of blades does not conform, in toto, to the requirements of IS: 6690-1981. This needs to be looked into for corrective action.
- 12.7 The chemical composition of blades does not conform, in toto, to the requirements of IS: 6690-1981. This needs to be looked into for corrective action.
- 12.9 Technical Literature:

One booklet entitled "Operator's Manual" was provided for reference during test. The same however, needs to be updated as per IS: 8132-1999.

TESTING AUTHORITY

SANJAY KUMAR
AGRICULTURAL ENGINEER

P. K. PANDEY
DIRECTOR

P. W. PANDEY

Draft test report Compiled by: Girdhari Lal, Technician

13. APPLICANT'S COMMENTS

No specific comments received from the Applicant.

