
व्यावसायिक परीक्षण रिपोर्ट COMMERCIAL TEST REPORT

संख्या/ No.: ROTAVATOR-337/2718/2021

माह/Month: July, 2021

THIS TEST REPORT VALID UP TO : 31st July, 2028

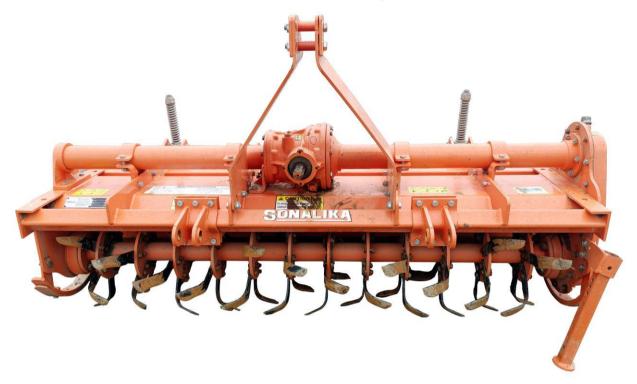

SONALIKA, SLCHASSJTR-6 ROTARY TILLER, (ROTAVATOR) TRACTOR MOUNTED



भारत सरकार

Government of India

कषि एवं किसान कल्याण मंत्रालय

Ministry of Agriculture and Farmers Welfare

कृषि, सहकारिता एवं किसान कल्याण विभाग

Department of Agriculture, Cooperation and Farmers Welfare

उत्तरी क्षेत्र कृषि मशीनरी प्रशिक्षण एवं परीक्षण संस्थान

Northern Region Farm Machinery Training and Testing Institute

ट्रैक्टर नगर, सिरसा रोड, हिसार, (हरियाणा) - 125 001

Tractor Nagar, Sirsa Road, HISAR (Haryana)-125 001 [ISO 9001:2015 CERTIFIED]

Website: http://nrfmtti.gov.in/

E-mail: fmti-nr@nic.in Tele./FAX: 01662-276984

Page 1 of 25

SONALIKA, SLCHASSJTR-6, ROTARY TILLER, (ROTAVATOR) TRACTOR MOUNTED (COMMERCIAL)

3.11 Lubricants:

Sl. No.	Particulars	As recommended by the manufacturer	As used during test
1	Primary Gear box	EP-140	Oil originally filled in the rotavator was not
2	Secondary Gear box	EP-140	changed
3	Rotor Hub	Not specified	EP-140
4	Propeller Shaft	Not specified	Lithium base grease

4. RUNNING - IN

Rotavator was run in for 1.0 hour before field performance test.

5. LABORATORY TEST

5.1 Hardness: - The surface hardness of blade was recorded as under: -

Description	As per IS:	Hardness as	Remarks	
17.0	6690:1981 (HRC)	observed (HRC)	The Black Co.	
Edge portion	53 to 59	42.03 (Average)	Does not conform	
On shank portion	37 to 45	42.8 (Average)	Conforms	

5.2 Chemical composition

The chemical composition of blades is tabulated as under:-

Constituents	As per IS: 6690-1981		Composition	Remarks
	Carbon Steel *	Silicon Manganese steel	as observed (% of weight)	had the
Carbon (C)	0.70 -0.85	0.50-0.60	0.182	Does not conform
Silicon (Si)	0.10 -0.40	1.50-2.00	0.283	Conforms to carbon steel
Manganese (Mn)	0.50 -1.0	0.50-1.00	1.054	Does not conform
Sulphur (S)	0.05(max)	0.05(max)	0.065	Does not conform
Phosphorous (P)	0.05(max)	0.05(max)	0.033	Conforms

6. FIELD PERFORMANCE TEST

The field tests of the rotavator comprising of dry land and wet land operation were conducted for 26.08 and 11.0 hours respectively to assess the performance test which is reported in **Annexure-I & II** for dry land and wet land operation respectively.

Observations of field performance test is summarized in the ensuing table:-

ROTAVATOR-337/2718/2021

SONALIKA, SLCHASSJTR-6, ROTARY TILLER, (ROTAVATOR) TRACTOR MOUNTED (COMMERCIAL)

Summary of Field Performance Test

Sl. No.	Parameters/operations	Dry land operation	Wet land operation (Puddling)
I	II	III	IV
1.	Tractor used	Sonalika DI-745 III	
2.	Gear used	L-1	L-1
3.	Type of soil	Sandy loam	
4.	Average soil moisture (%)	17.63 to 18.53	-
5.	Average depth of standing water (cm)		8 to 9
6.	Bulk density of soil (g/cc)	1.715 to 1.790	
7.	Average speed of operation (kmph)	2.78 to 2.82	2.05 to 2.07
8.	Avg. travel reduction (%)		-8.0 to -6.5
9.	Avg. wheel slip (%)	-0.64 to 0.35	
10.	Average depth of puddle (cm)		14.5 to 16.1
11.	Average depth of cut (cm)	10.1 to 10.3	
12.	Avg. effective width (cm)	174 to 175	
13.	Area covered (ha/h)	0.373 to 0.398	
14.	Time required for one ha (h)	2.51 to 2.68	
15.	Field efficiency (%)	76.43 to 80.73	
16.	Puddling index (%)	of Pro-	76.92 to 79.61
17.	Fuel consumption		
	. 1/h	5.04 to 5.14	3.25 to 3.31
	l/ha	12.81 to 13.56	delenda (LL
18.	Avg. PTO power consumption, kW	14.74	

6.1 Dry land operation

6.1.1 Rate of work

- i) The rate of work was recorded 0.373 to 0.398 ha/h, and the speed of operation varied from 2.78 to 2.82 kmph.
- ii) The time required to cover one hectare was recorded as 2.51 to 2.68 h

6.1.2 Quality of work

- i) The depth of operation was recorded as 10.1 to 10.3 cm.
- ii) Average effective width was observed as 174 to 175 cm.
- iii) Field efficiency was observed as 76.43 to 80.73 %.

6.2 Wet Land operation

6.2.1 The tractor was run without half cage wheel on rear pneumatic traction wheel for conducting the puddling operation.

6.2.2 Quality of work

- i) The depth of puddle was recorded as 14.5 to 16.1 cm.
- ii) The puddling index was recorded as 76.92 to 79.61 %.

ROTAVATOR-337/2718/2021

SONALIKA, SLCHASSJTR-6, ROTARY TILLER, (ROTAVATOR) TRACTOR MOUNTED (COMMERCIAL)

6.3 Labour requirement

In all, two skilled operators are needed to ensure continuous operation of rotavator for day long period.

6.4 Wear analysis (on mass basis)

Wear of hatchet blades (on mass basis) was measured and recorded in ensuing table:

Percentage wear of rotavator blades on mass basis

Sl. No.	Initial mass of blade (g)	Mass of blade after 38.08 hr. of operation (g)	Difference of weight (g)	Percentage of wear (%) after 38.08 hr.	Percentage of wear on hour basis (%)
1.	515.2	496.0	19.2	3.73	0.10
2.	523.0	505.2	17.8	3.40	0.10
3.	503.0	485.1	17.9	3.56	0.09
4.	510.6	493.5	17.1	3.35	
5.	518.4	498.6	19.8	3.82	0.09
6.	516.3	498.1	18.2		0.10
7.	511.0	493.0	18.0	3.53	0.09
8.	513.0	495.2		3.52	0.09
9.	512.0		17.8	3.47	0.09
		494.6	17.4	3.40	0.09
10.	507.5	490.0	17.5	3.45	0.09
11.	508.1	489.0	19.1	3.76	23/65/5
12.	497.6	478.6	19.0	3.82	0.10

7. EFFECTIVENESS OF SEALINGS

After completion of wet land operation for 11.0 hours, the rotavator was dismantled for checking the effectiveness of sealing provided against ingress of dust, and water/mud in various sub-assemblies/components. The observations are given in ensuing table:-

Sl. No.	Location	Whether ingress of mud and/or water was observed (Yes/No)
1.	Primary reduction gear box	
2.	Secondary reduction gear box	No
3.	Rotor assembly (hub)	No
	(nuo)	No

8. EASE OF OPERATION & ADJUSTMENTS

No noticeable difficulty was observed during the operation and adjustment of rotavator

9. DEFECTS, BREAKDOWN AND REPAIRS

No defect observed during the test.

ROTAVATOR-337/2718/2021

SONALIKA, SLCHASSJTR-6, ROTARY TILLER, (ROTAVATOR) TRACTOR MOUNTED (COMMERCIAL)

11. CRITICAL TECHNICAL SPECIFICATION

(Vide Ministry's communication No 13-9/2019 M &T (I&P) dated 26.04.2019)

N	0	munication No 13-9/2019 M &T (Specification	Observed	Remark
1.	Working width (mm)	1200 (14)		
2.	Type of blade	1200 (Min.)	1765	Conform
3.		C/L/J shape as per demand Hatchet blade	J-shape	Conform
4.	Thickness of blade (mm)	7-8 (Min.)	07	0.0
5.	No. of blades	30(Min.)	72	Conforms
	Total Number of flanges	5 (M:-)		Conforms
6.	Number of blades per flanges	6 (Max.)	12	Conforms
7.	Outer diameter of rotor shaft	75-90	06	Conforms
	mm	13-70	75	Conforms
8.	Rotor diameter, including flange and blade mounted on flange, mm	425 (Min.)	480	Conforms
9. 10.	Side Drive	Gear Drive /Chain Drive (Optional)	Gear drive	Conforms
	Depth control mechanism	Arc shaped skid on both side of rotavator	Skid on both Side of	Conforms
11.	Material of blades	Boron 27/28/30 Mn	rotavator	
12.	The state of the s	(28MnCrB5) / High Carbon steel of grade EN42/EN45/EN47	Boron	Conforms
	Hardness of blade Material, HRC	38 (min)	42.03	Conforms
13.	Safety clutch/Device (Shear bolt) in PTO drive shaft	Must be provided	Provided	Conforms
4.	Rotavator stand	March 1		
5.	Guard over propeller shaft	. Must be provided	Provided	Conforms
6.	Sheet metal	Must be provided	Provided	Conforms
7.	Marking/labeling of machine	AS36 / IS 2062	IS:2062	Conforms
	and the state of t	The labeling plate should be riveted on the body of machine having Name and address of manufacturer, Country of Origin, Make, Model, Year of manufacturer,	Partially meet the requirement	Partially Conform
	Literature	Serial Number, Type, size, required of prime mover (kW) Operator manual, Service manual and Parts catalogue should be provided.	Provided	Conforms

SONALIKA, SLCHASSJTR-6, ROTARY TILLER, (ROTAVATOR) TRACTOR MOUNTED (COMMERCIAL)

12. COMMENTS AND RECOMMENDATIONS

- 12.1 The Dimension of three point linkage of implement does not conform, in toto, to the requirements of IS: 4468(Part-1)-1997 and therefore, it may be looked into for corrective action.
- 12.2 The Dimension of PIC of Implement does not conform, in toto, to the requirements of IS: 4931-1995 and therefore, it may be looked into for corrective action.
- 12.3 The grade of grease is not specified. It MUST be specified
- 12.4 The hardness of blades does not conform, in toto, to the requirements of IS: 6690-1981.
 This needs to be looked into for corrective action.
- 12.5 The chemical composition of blades does not conform, in toto, to the requirements of IS: 6690-1981. This needs to be looked into for corrective action.
- 12.6 The recommended PTO speed of Prime mover is not specified on the labeling plate. It MUST be looked into.
- 12.7 The country of origin is not specified on the labeling plate. It MUST be looked into.
- 12.8 Technical Literature:

One booklet entitled "Owners" was provided for reference during test. The same, however, needs to be updated as per IS:8132-1999.

TESTING AUTHORITY

Er. G.R. AMBALKAR AGRICULTURAL ENGINEER	Ambalkarz
Dr. MUKESH JAIN DIRECTOR	
	31.07.2021

13. APPLICANT'S COMMENTS

Para No.	Our Reference	Applicant's comments	
13.1	12.1	Will be improve/take care our regular production as per IS:4468 (Part-1)-1997, also change the correct dimension in our drawing.	
13.2	12.2	Will be improve in our regular production as per IS:4931-1995.	
13.3	12.3 & 12.4	Will be update the same in our owner manual	
13.4	12.5 & 12.6	Will be take care in our regular production as per IS:6690-1981.	
13.5	12.7 & 12.8	Will be update the labeling plate	

4.T.&T.